





# VIS-CHECK SAFETY AND EFFICIENCY REPORT

**Vehicle ID** S863AN      **VIS S/N** 15025      **VIN** 0160      **Odometer** 703182      **Reference**  
**Date** 3:42 pm 08-Mar-2017 **Test #** 2721      **Axles** 2      **Inspector** 592      **Customer ID**  
**Cal Due** 30-Aug-2017      **Cal** Valid      **Validity** Valid Test      **Class** NHVR 4.5'      **Overall Result** **Passed**  
**Total Max. Deceleration** Req.( >=4.5 )      6.9 m/s/s      **Passed** **Total Weight**      Req.( )      9189 kg

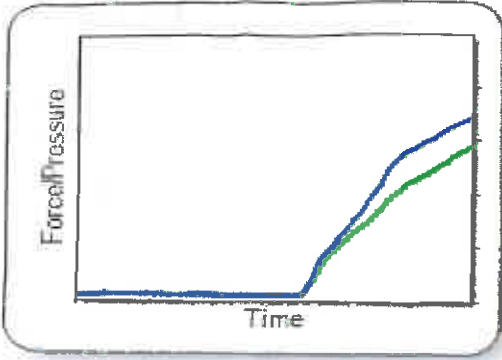

## Axle 1

Requirement	Left	Right	Total	P/F	Unit
Max. Brake Force	12754	15070	27824		N
Weight	2012	2069	4081		kg
Park Brake Force					N
Net Rolling Res.	146	159	305		N
Brake Balance	>=70	84	84	Passed	%
Max. Deceleration	>=4.5	6.3	7.3		m/s/s

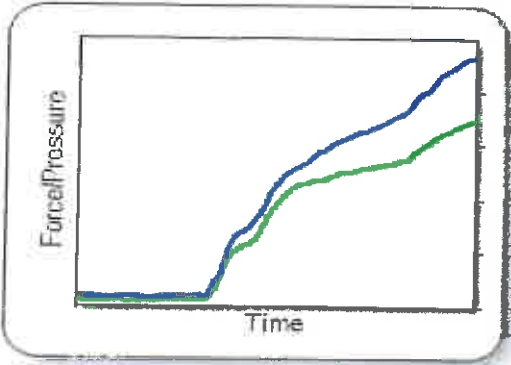

## Axle 2

Requirement	Left	Right	Total	P/F	Unit
Max. Brake Force	15169	20279	35448		N
Weight	2543	2565	5108		kg
Park Brake Force	7125	8243	15368		N
Net Rolling Res.	173	299	472		N
Brake Balance	>=70	74	74	Passed	%
Max. Deceleration	>=4.5	6	7.9		m/s/s